

COACH MODEL

CX35 & CX45 with Eberspächer Heater Units

DATE


03.20.2026

SUBJECT

Coolant Leak Fix; 17mm Bolt Adjustment

If you are experiencing coolant leak issues with the 17mm bolt atop your coach's heater unit, please follow the steps below:

1. **Turn off** the coach and **open** the heater compartment door (roadside of the coach).

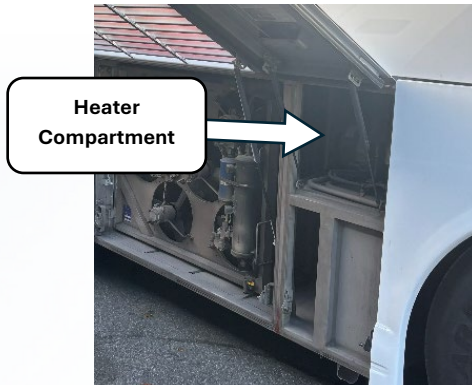


2. **Place** a drain pan underneath the heater compartment to catch any coolant discharge.



3. **Clamp** the backside heater hose, then **close** the supply shut-off valve (located behind the heater).



4. **Remove** the 17mm bolt and **inspect** the O-ring for any damage. If necessary, **replace** the O-ring before re-installation.

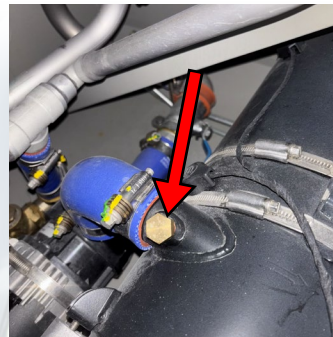

5. **Replace** the 17mm bolt and **tighten** by hand.
6. **Torque** to 14.75 ft-lbs (20 Nm).



Order today with ABC's Parts Source!

Please visit our online parts store at store.abc-companies.com or call 877.427.7278, option 4! Check out the parts to order below:

Part #	Description	QTY
B447866	Plug, Screw-in – 17mm	1
B447867	Ring, Sealing (O-ring)	1