TECH TIPS

Because of installation inconsistency, with the VanHool fuse holders. It is therefore necessary to inspect the installation of these fuse holders to make sure that the system complies with the design specification. The inspection applies to the fuse holders in the right front dash electrical box. In (figure 1) shows the correct installation. In (figure 2 & 3) are the two possibilities of the incorrect installations.

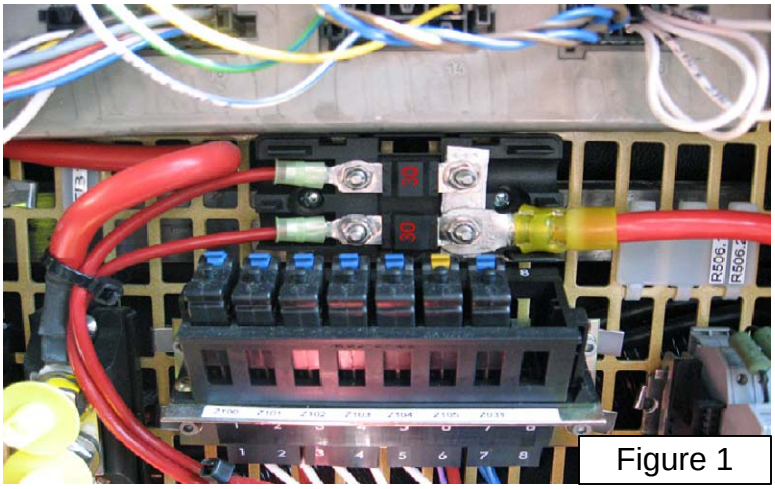


Figure 1

The following list of VIN's below need to be inspected and corrected as needed. 47471, 47472, 46736, 46755, 47526, 47527, 46797,47451, 47431, 47528, 46796, 47483 & 47496.

Here in figure 2 has the wrong fuses installed with two 50 amp fuses. They need to be replace with 30 amp fuses part number; 10930132.

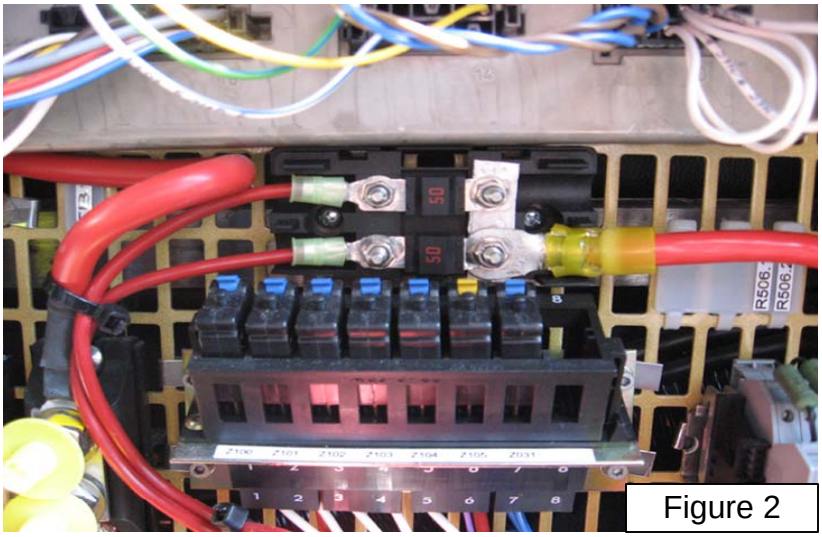


Figure 2

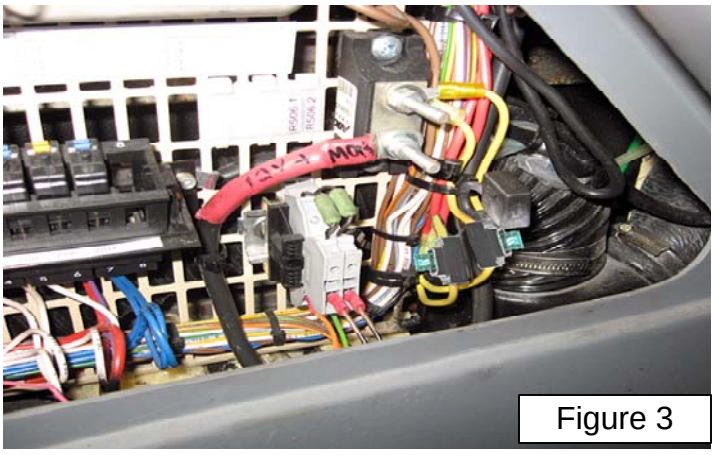


Figure 3

Here in figure 3 there was two inline fuses use that to be replace with the following part numbers; 10930132 (30 amp fuse) & 10947652 (4 fuse block, needs to be cut in half).