
ABC COMPANIES
Exclusive U.S. VANHOOL Distributor


TECH TIPS
#1104

COACH MODEL :	C2045 & T2100
DATE :	02/03/2011
SUBJECT :	HVAC Check Valve Change

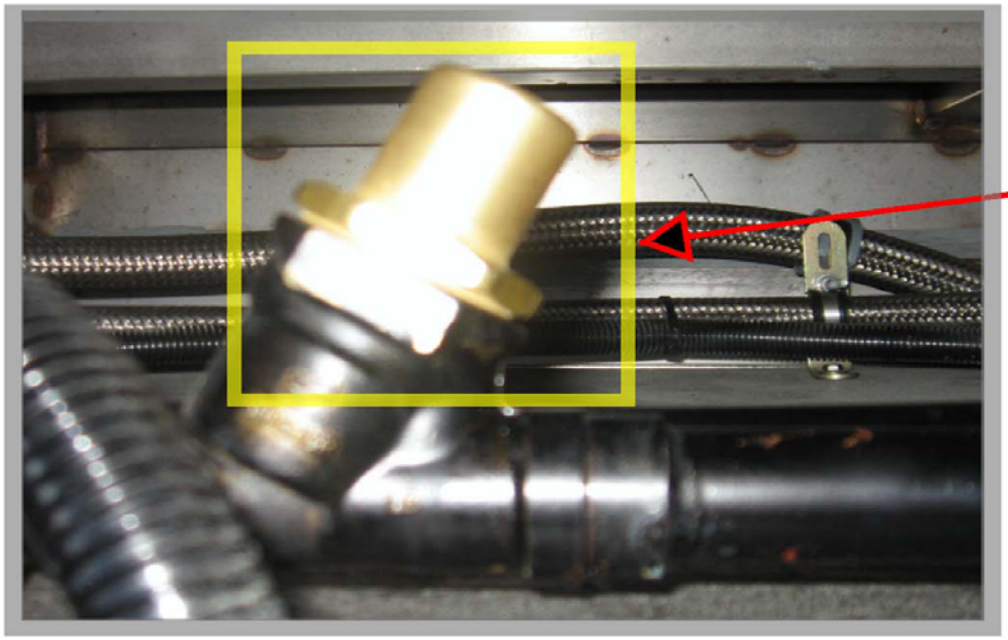

You can ID the new style check valve with the raised center on the cap

NEW
Part numbers
VH # 11184588
or Carrier #
14-00281-04

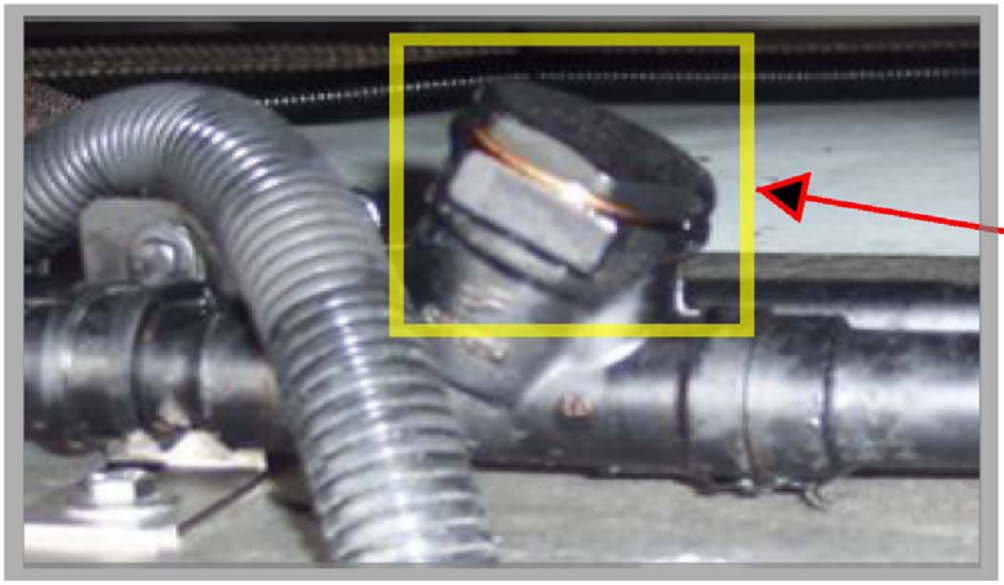

The old style has the flat cap

It has been noticed when a C or T coach is in A/C mode and the engine is at regular idle RPM's that the check valve behind the condenser may make a knocking noise. Check the system to verify the correct operating pressures and refrigerant level is ok. If noise still continues ,replacement of the check valve will be necessary