


COACH MODEL : CX45, CX35
DATE : April 1, 2020
SUBJECT : No Crank, Rear Engine Door Sensor

Model Year 2020 CX45 and CX35 are equipped with rear engine door safety switches. The engine will not crank using the drivers start button if the engine door is left open.

There are two switches that are located on the left and right side of the engine compartment (refer to the electrical schematic below).

The sensors are similar to wheelchair door sensors and operate in the same manner. The engine door must be closed, which magnetically closes the switches and allows the engine to crank from the drivers start button.

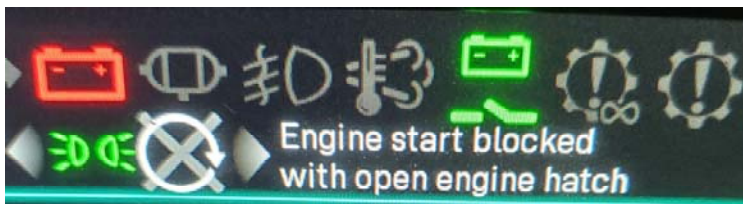

The message shown above on the MVP Dash Display alerts the driver if the door is left open.



Right side sensor shown above, left side similar.

