
CIRCUIT BREAKER HOUSING WITH JUMPERS

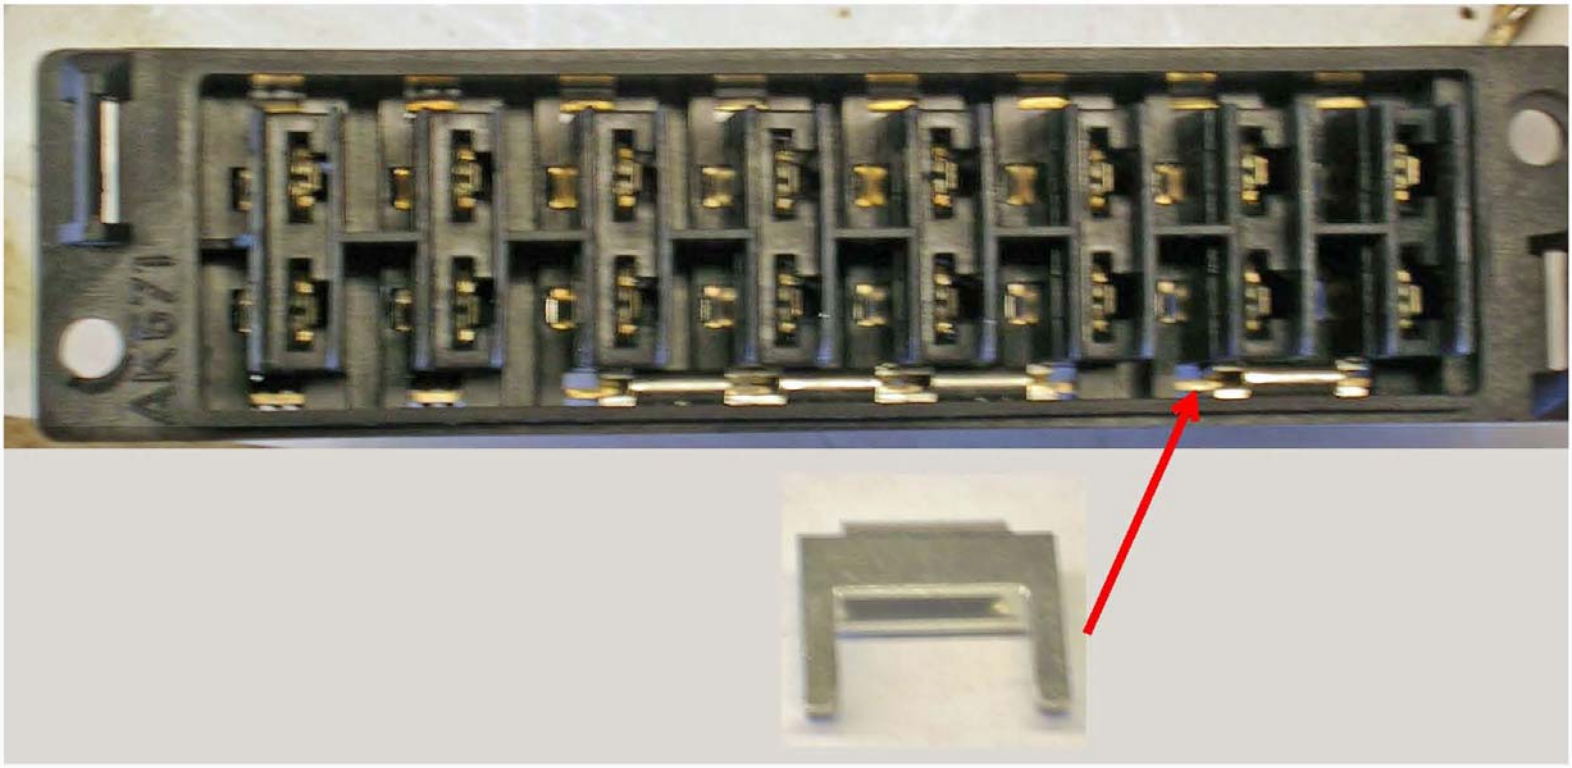

VIN # 44642 Problem, brake lights work intermittently found that the jumpers where not installed properly. When they where installed they did not saddle the connector shown by arrow, both side of jumper where on one side. All five jumpers where the same. This coach had this problem before with the jumper for the evaporator fans a few weeks ago.