


**COACH MODEL :** CX 35 and CX 45  
**DATE :** November 20 2022  
**SUBJECT :** Wiring Modification when replacing complete mirror assembly

Older coaches use a 3-pin control for the mirrors and the new mirrors use a 4-pin control setup. In order to remedy this, the 8-pin plug on the coach side must be rewired as follows:

Remove Pins 1,2, and 4 (should be red, black, and green wires, respectively)  
 Cut off the terminals of pins 2 and 4.  
 Crimp wires from pins 2 and 4 together into a new pin and insert into pin 1.  
 Insert wire from pin 1 into pin 2.

The diagram below shows the factory plug on the left and the modified plug on the right .

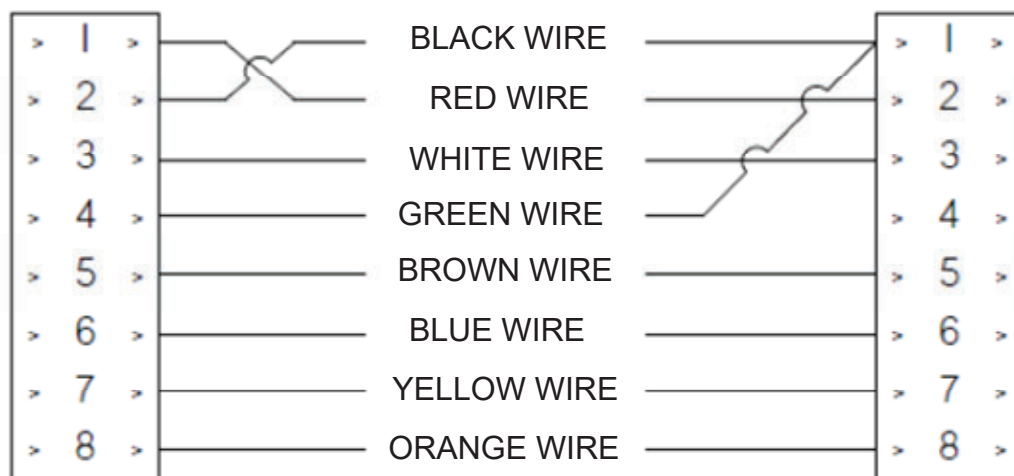

Moving forward, a plug and play adapter harness will be provided with a new mirror purchase. When replacing the mirror simply install the harness shown below to avoid wiring modifications. The adapter harness is not available separately.

